

PHILIPS *Service*

INFORMATION

RECORDERS

23-3-1964	EL 3534 - EL 3549	Bc 442
-----------	-------------------	--------



NOTE : The apparatuses in which measurements have been taken concerning mechanical noise, as stated in information sheet Bc 430, are distinguishable by the stamp WR06 46/63.

The following points pertain to additions and corrections :

- The bracket, item 206, for securing the modulation indicator, is available under code number 4822 212 00421 for the EL 3534 and code number 4822 212 00422 for the EL 3549
- The spring of the quick-stop brake 28 has been lengthened to provide additional stability.
Bracket 28 is available under code number 4822 215 00856.
- Switching-cam 146 has been shortened at the top by 1.5 mm.
The height of bracket 138 is reduced by 1.5 mm.
Consequently the metal cover rests more freely, thus reducing chances of mechanical noise.
If a new switching-cam 146 needs to be mounted, then either the space between switch-cam 146 and bracket 138 must be filled up with washers (A9 868 65), or a new bracket 138 should be used.
Code number of switching-cam (50 c/s) 4822 215 00836
Code number of switching-cam (60 c/s) 4822 215 00853
Code number of bracket 4822 212 00423
- In the position where bracket 147 might touch disc. 74, a rubber stop strip has been glued.
Bracket 147 including the stop strip is available under code number 4822 215 00854.
- To prevent vibration of the right-side brake bracket a spring pressure washer has been fitted under the clamping ring.
Code number B 046 AA/4.

CENTRAL SERVICE

A. Remmers

