

RE CAR RADIO SERVICE MANUAL QP67A.

Code change under resistors and controls:

Code for RV1.2.S1 Tone + Volume  
+ Switch is now

4802 102 27091

RE CAR RADIO SERVICE MANUAL QP68A.

Code change under tuner assembly:

Code for Tuner Unit Complete is now  
Code for Tuning Shaft + Trimmer is now  
Code for Push Buttons is now

4802 210 17075

4802 125 57079

4802 410 27034

RE CAR RADIO SERVICE MANUAL OF65.

Add the following codes:

Knob Rear Balance  
Knob Rear  
Knob Front (x2)  
Dial Scale

4802 412 37012

4802 413 97138

4802 413 47131

4802 333 37033

RE DATSUN 200B ANTENNA.

With the car radio antenna fitted to the Datsun 200B SX and 200B GX, only the pillar mounted aerials are of Philips origin. The centre roof mounted aerials are from another supplier and Philips has no warranty or replacement parts obligation for these.

RE MOTORISED AERIAL MAST ASSEMBLY 4802 303 27002.

Future supplies of this item will have a nylon cord 2 metres long, and it will be necessary to cut this cord to the appropriate length before fitting to the aerial being serviced.



CROSS REFERENCE CODES O.E.M. CAR AUDIO

<u>SINGAPORE P/NO.</u>	<u>PHILIPS P/NO.</u>	<u>FITMENT</u>	
DC 568/69 DC 568/69E	CS210A CS210A	PULSAR/ASTRA PULSAR/ASTRA	2 SPKR
DC 568/69S DC 568/69B	CS211A CS211A	PULSAR/ASTRA PULSAR/ASTRA	2 SPKR
DC 668/69 DC 668/69E	CS212A CS212A	PULSAR/ASTRA PULSAR/ASTRA	4 SPKR
DC 568/69L	CS216A	SKYLINE/PINTARA	2 SPKR
DC 668/69L	CS217A	SKYLINE/PINTARA	4 SPKR
DC 668/70	CS213AA	FORD FALCON (YELLOW)	2 SPKR
DC 668/70B	CS214A	FORD COMMERCIAL (WHITE)	2 SPKR
DC 668/70L	CS215AA	FORD LASER/METEOR (ORANGE)	2 SPKR
DC 668/70T	CS223A	FORD TELSTAR (WHITE)	2 SPKR
DC 568/78E	CW029A	HOLDEN CAMIRA	2 SPKR



# Information

Re Car Radio 02AN279A:

Code change under Miscellaneous Mechanical.  
Code for Nose Piece is now 4802 459 57026.

Re Car Stereo Cassette Player AC370: (Manual not yet issued)

- Fault - "Wow" under bumpy road conditions.  
Cause - Lugs on item 29 (detecting Plate A) in the tape deck exploded view are incorrectly bent.  
Cure - Bend lugs away from tape.

Re Car Stereo Cassette/Radio CS822A:

Add to Replacement Parts List


Knob Tone	4802 413 97135
Knob Rear (Plain)	4802 411 57022
Knob Front	4802 413 47129

Re Car Radio 0P49A:

This manual has been issued as "Car Radio Toyota Part No. 86120 - 30221" - Add "0P49A" to the heading.

Re Car Radio 0P45:

- Fault - Buzzing noise either continuously or just when the receiver is turned on.  
Cause - Poor contact between I.C. heat sink and chassis  
Cure - Replace 3x6 mm screw with new one and add spacer 4802 404 27065 as per sketch.

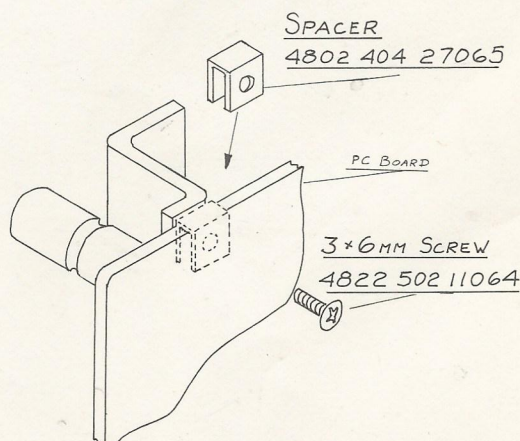



Re Car Radio NP48A as Fitted to Toyota Corona:

Fault - Ticking noise, mainly at the low end of the band when the motor is running.

Cure - 1. Re-route the white co-axial lead on the back of the printed wiring board, away from the local oscillator circuit.

2. Make sure that the printed wiring board is earthed to the back of the top lid.

Re Car Stereo Cassette Player TA5A:

Code change under transistors and diodes.

Code for IC1 is now 4802 209 87107

Re Car Radio OP51

Code Change under Miscellaneous.

Code for Dial Scale Printed is now 4802 331 37028