

AUTO RADIO SERVICE BULLETIN.

SUBJECT: 1939 Oldsmobile Car Model 60.
Fitting Airchief Part No. M10120.

It will be found necessary to turn the car light switch on this model before fitting radio control, because the contacts of switch would foul and short to the radio control cables, etc.

The switch in this model is at left hand of bottom centre instrument group, and the switch can be turned by loosening off the lock nut at back of switch knob bush, and tuning contacts and connections so that they face the side of glove box. It will be found that it is easier to make this adjustment if the whole center escutcheon is removed by four screws at back of instrument panel, to be able to get at and view lock nut of light switch.

SUBJECT: 1939 Oldsmobile Car Model 70.
Fitting Airchief Part No. M10122.

The set fixing holes of this car have not been located in correct position to clear the stay for the cowl vent mechanism. Fresh holes should be drilled using template supplied with set, watching position of stay in question.

SUBJECT: 1939 Pontiac & 1939 Oldsmobile Car Model 60.
Fitting Airchief Part No. M10122.

The set fixing holes of these cars have not been located in correct position to clear the choke control cable. Fresh holes should also be drilled on these cars, using template supplied with set, and watching position of choke cable where it goes through the fire wall, otherwise the set will jamb the choke control.