

AUTO RADIO SERVICE BULLETIN.

SUBJECT - ELIMINATION OF EXCESSIVE HUM AT LOW VOLUME
IN TYPE EB AUTO RECEIVER. (RECEIVER MODEL NOS.
6395 AND 12395.

To correct this complaint, the following procedure should be observed.

1. Unscrew the three holding down bolts located on top of the chassis, and carefully remove the chassis from the can, taking care that the gang or padders are not damaged in doing so.
2. Locate the circuit point marked 43 on the circuit and chassis drawings. This is a 1 meg 1/4 watt resistor (PR110) connected between the volume control and the negative bias choke.
3. Remove this resistor and substitute a 3 meg 1/4 watt resistor (PR211).

This bulletin will apply to set numbers - 49000 to 49700, 46000 to 46250, 54000 to 54030, and 54500 to 54560 only.

DESIGN DEPARTMENT.

ISSUED BY ENGINEER
J.P.S.
