

11 - 21 STURT STREET, SOUTH MELBOURNE.AUTO RADIO SERVICE BULLETIN.SUBJECT - SPEAKER REPLACEMENT IN MODEL 60 ANDMODEL 220 ASTOR.

When replacement of speakers is necessary, special care should be taken when tightening the four holding down screws. Owing to the fact that the receiver case face may have a slight buckle on its surface and also that the flange of the speaker is unsupported directly beneath the nuts, it is possible to distort the speaker flange by applying excessive pressure at these points. Speakers have been returned to us which have been caused to rattle by the distortion of their housing by this means. This fault does not necessarily show up directly the speaker is installed but the continued distortion gradually puts a permanent deflection on the spider which causes the voice coil to rub in the air gap. Care in tightening the four screws holding the speaker so that just sufficient pressure is applied to ensure the speaker holding in position, will be a big factor in preventing recurrence of this fault.

-----