

11 - 21 STURT STREET, SOUTH MELBOURNE. 25.1.38.AUTO RADIO SERVICE BULLETIN.SUBJECT - INSTALLATION OF REMOTE CONTROL FOR
1938 HUDSON CAR.

No control fixing holes exist in the Instrument panel of this car only the aperture for the dial. Two 13/32" diameter holes have to be drilled, 2-7/8" centers, 1-7/16" each side of center of the dial aperture.


To instal control remove cover plate from center of Instrument panel by removing nuts at back and countersunk screw at bottom of Instrument panel.

Control holes as explained above on lines of diagram on Page 2 of this bulletin. Replace escutcheon supplied with Control in place of cover plate, and instal control in the usual way.

INSTALLATION OF REMOTE CONTROL FOR
1938 TERRAPLANE CAR.

The 1938 Terraplane Instrument panel has an escutcheon which will be required to have a portion, 4" wide, cut from the center which now covers the dial aperture and control fixing holes.

The escutcheon supplied with control is then fitted on top of this aperture and the end of the escutcheon is used to clamp the cut portion of the original escutcheon in position as per printed installation instruction sheet supplied with Remote control.

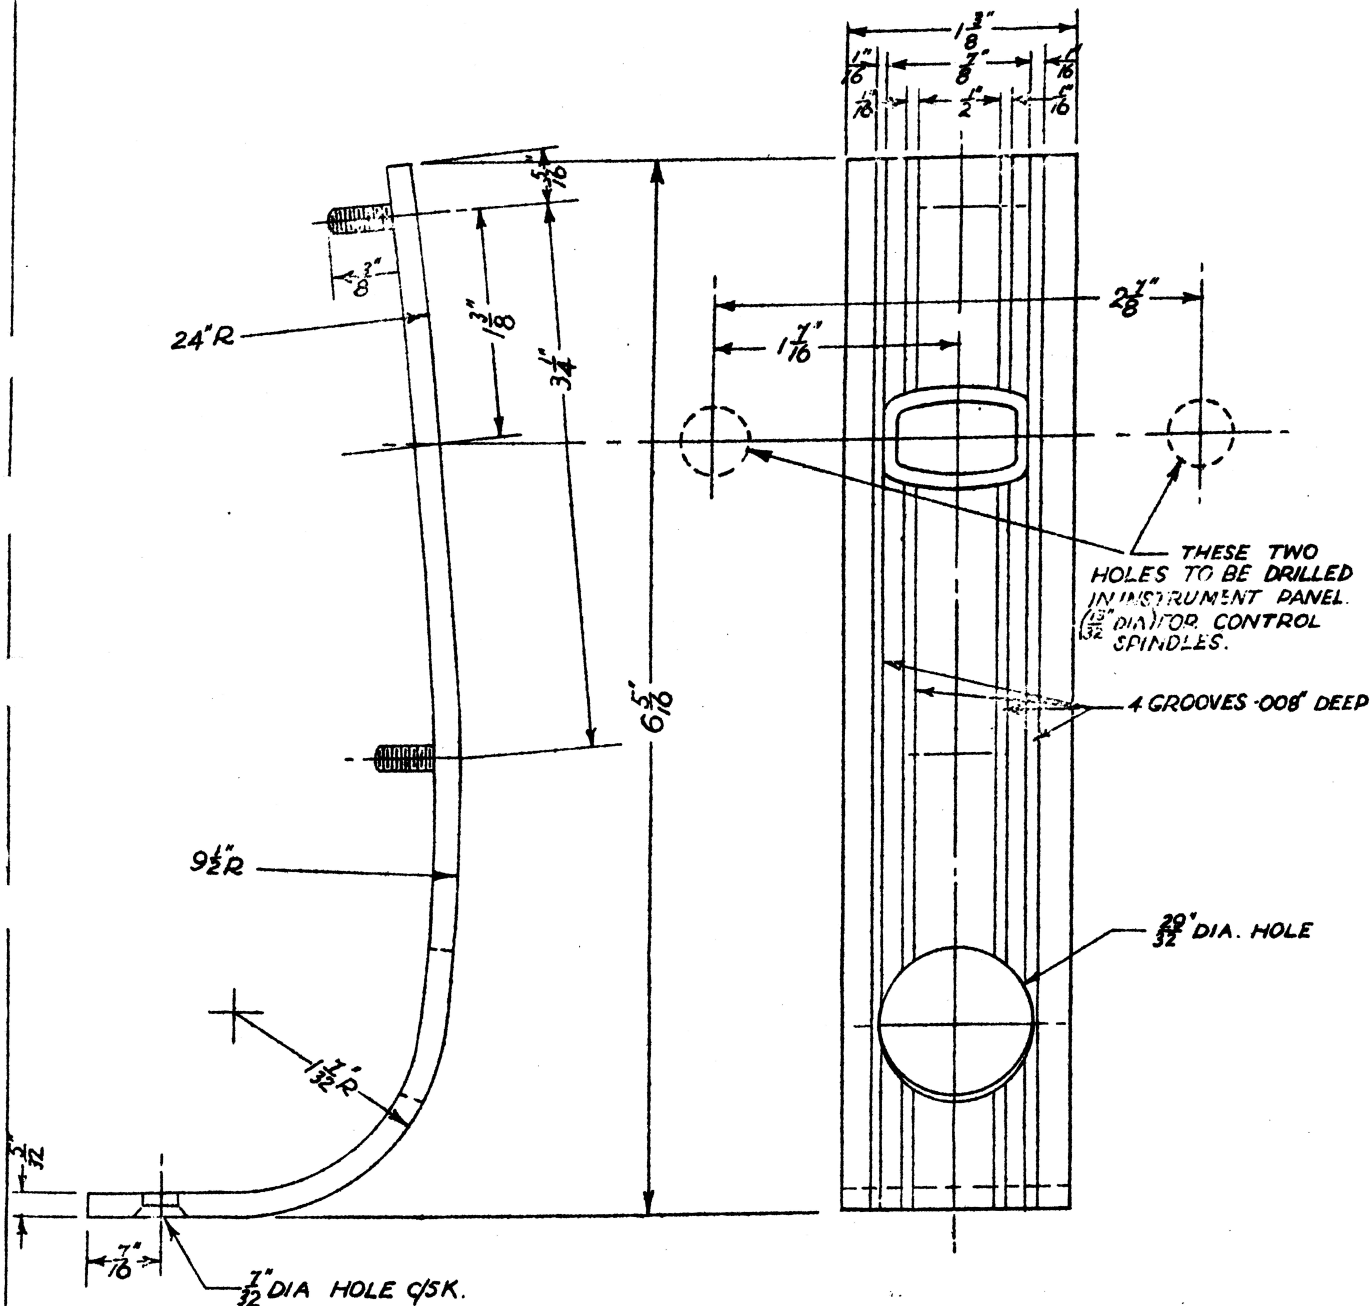

ESCUTCHEON PLATE
1938 HUDSON REMOTE CONTROL
1 OFF PER ASS. BRASS SANDCASTING